

Monitoring Data Record

Project Title: R-3427 (US 601 Widening) COE Action ID: 200421361 & 200421362  
Stream Name: UT Dry Branch (Site 6) DWQ Number: 3403  
City, County and other Location Information: US 601, Yadkin County (64+20-66+08)  
Date Construction Completed: Water turned 7-27-06 & Reforestation completed 3-10-06  
Monitoring Year: ( 4 ) of 5  
Ecoregion: \_\_\_\_\_ 8 digit HUC unit 03040101  
USGS Quad Name and Coordinates: \_\_\_\_\_

**Rosgen Classification:** \_\_\_\_\_

Length of Project: 220' Urban or Rural: Rural Watershed Size: \_\_\_\_\_  
Monitoring DATA collected by: M. Green, J. Young Date: 3/9/10

**Applicant Information:**

Name: NCDOT Roadside Environmental Unit  
Address: 1425 Rock Quarry Road Raleigh, NC 27610  
Telephone Number: (919) 861-3772 Email address: mlgreen@ncdot.gov

**Consultant Information:**

Name: \_\_\_\_\_  
Address: \_\_\_\_\_  
Telephone Number: \_\_\_\_\_ Email address: \_\_\_\_\_

**Project Status:** Complete

---

---

**Monitoring Level required by COE and DWQ (404 permit/ 401 Cert.):** Level ( 1 ) ~~2~~ ~~3~~

Monitoring Level 1 requires completion of *Section 1, Section 2 and Section 3*

**Permit States:** NCDOT shall perform the following components of Level I monitoring twice each year for the 5 year monitoring period (summer and winter): Reference photos, plant survival, and visual inspection of channel stability. If less than two bankfull events occur during the first 5 years, NCDOT shall continue monitoring until the second bankfull event is documented. The bankfull events must occur during separate monitoring years. In the event that the required bankfull events do not occur during the 5 year monitoring period, the USACE, in consultation with resource agencies, may determine that further monitoring is not required.

---

---

Section 1. PHOTO REFERENCE SITES

*(Monitoring at all levels must complete this section)*

**Total number of reference photo locations at this site:**

**A total of 8 photos were taken from 3 photo point locations.**

**Dates reference photos have been taken at this site: 1/6/07, 8/22/07, 1/30/08, 5/28/08, 1/13/09, 6/23/09, 3/9/10**

---

---

**Individual from whom additional photos can be obtained (name, address, phone):** \_\_\_\_\_

---

---

Other Information relative to site photo reference: A site map with photo point locations is attached to this report.

If required to complete Level 3 monitoring only stop here; otherwise, complete section 2.

**Section 2. PLANT SURVIVAL**

**Attach plan sheet indicating reference photos.**

Identify specific problem areas (missing, stressed, damaged or dead plantings):

---

---

Estimated causes, and proposed/required remedial action: \_\_\_\_\_

---

---

ADDITIONAL COMMENTS: Planted vegetation is surviving. Planted vegetation includes black willow, silky dogwood, green ash, river birch, and sycamore. Other vegetation noted on site includes goldenrod, woolgrass, *Juncus* sp., *Sagittaria* sp., cattail, kudzu, *Scirpus* sp., horse-nettle, poplar, sweetgum, and various grasses.

If required to complete Level 1 and Level 2 monitoring only stop here; otherwise, complete section 3.

**Section 3. CHANNEL STABILITY**

**Visual Inspection:** The entire stream project as well as each in-stream structure and bank stabilization/revetment structure must be evaluated and problems addressed.

Report on the visual inspection of channel stability. Physical measurements of channel stability/morphology will not be required. Include a discussion of any deviations from as-built and an evaluation of the significance of these deviations and whether they are indicative of a stabilizing or destabilizing situation.

Stream is highly stabilized for the Year 4 Winter evaluation. All cross vanes are functioning properly and streambanks are stabilized with woody and herbaceous vegetation. A bankfull event has occurred since the last monitoring evaluation. NCDOT will continue to monitor this stream relocation.

---



---

Date Inspected	Station Number				
Structure Type					
Is water piping through or around structure?					
Head cut or down cut present?					
Bank or scour erosion present?					
Other problems noted?					

**NOTE:** Attach separate narrative sheets to each monitoring report describing/discussing the overall monitoring results. Include the identification of specific problem areas/channel failures, estimated cause and proposed/required remedial action. This should include a brief discussion of any parameter that has changed significantly from as-built.

# UT Dry Branch



Photo Point #1 (Upstream)



Photo Point #1 (Downstream)



Photo Point #2 (Upstream)



Photo Point #2 (Downstream)



Photo Point #3 (Upstream)



Photo Point #3 (Downstream)


# UT Dry Branch



Photo Point #3 (Buffer Area)



Photo Point #3 (Buffer Area)

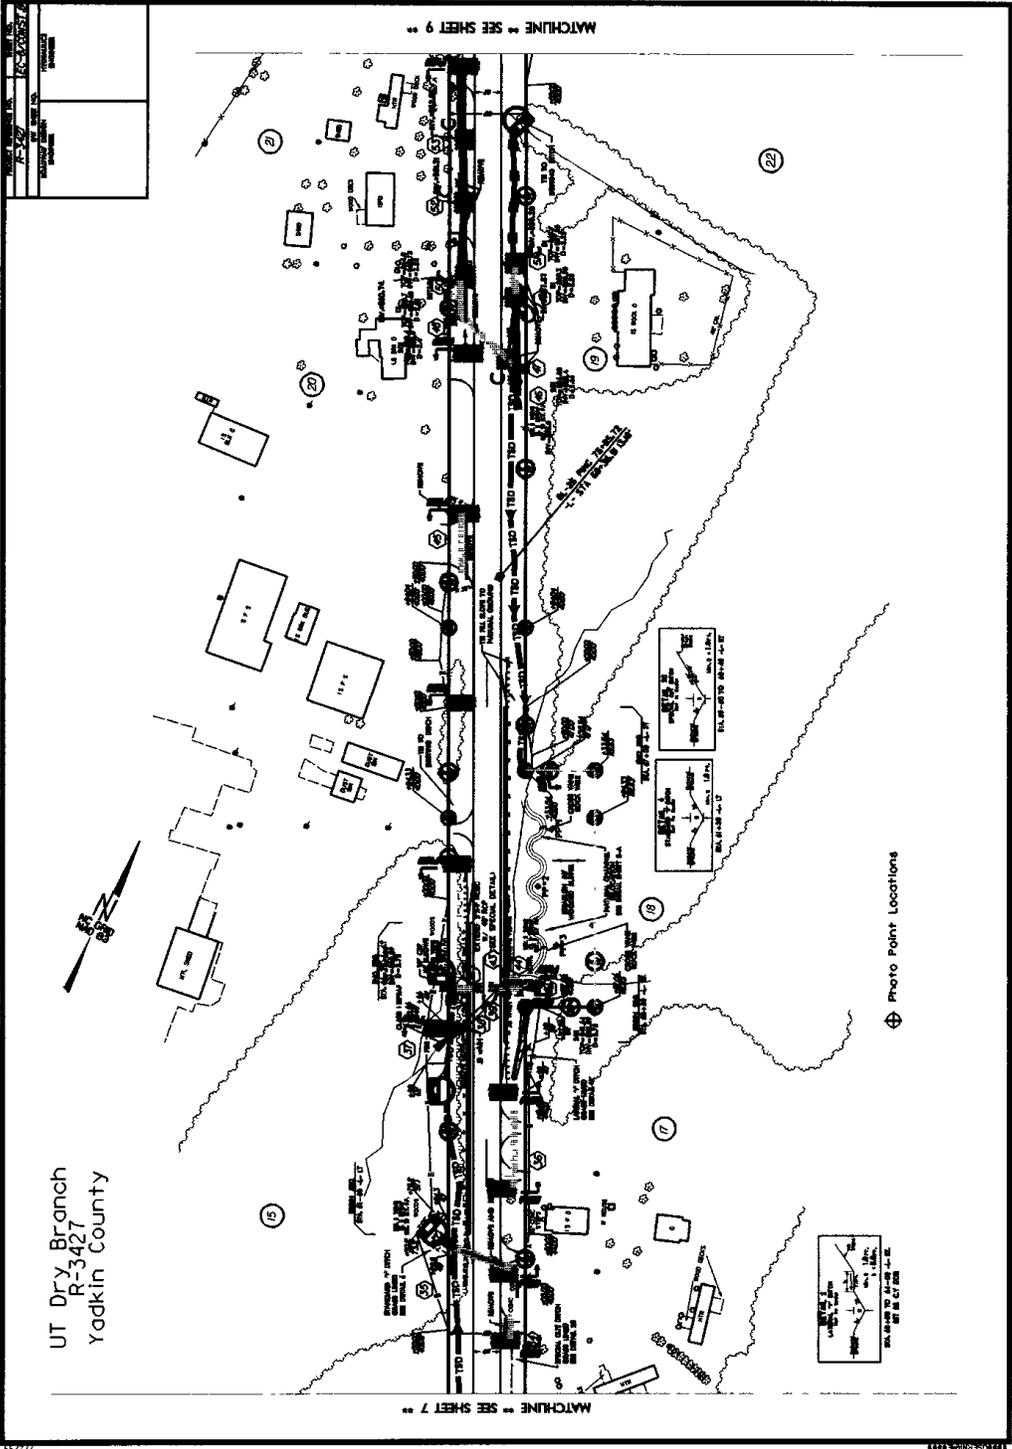

DATE	BY	REVISION
11-12-01	J. W. HARRIS	ISSUED FOR PERMITS
11-12-01	J. W. HARRIS	ISSUED FOR PERMITS
11-12-01	J. W. HARRIS	ISSUED FOR PERMITS