


16_41 Seeding Reports Errors in Mountainous Areas

Question:

Having problems running the seeding report for some stations. *example 154+00, 154+50...

Answer:

The error message pertains to "Dangling" proposed elements not connecting to existing ground or to another proposed element. This is half right. Look at the picture below. The error states that the problem is at station 154+50 but the DP points is pointing to the tie at 155+00.

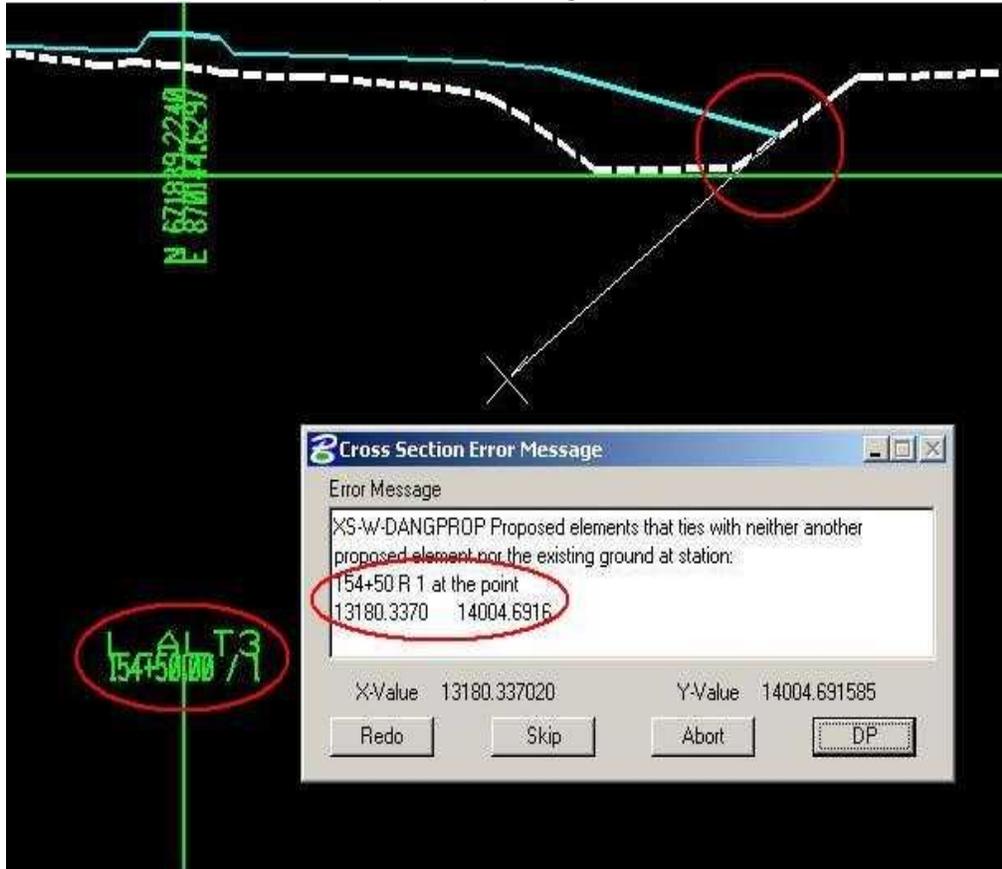

This a common problem on mountainous jobs where the green cross section cells are close to each other due to the drastic elevation differences. My recommendation is to copy the xsc file, and just for seeding report only, in the station ranges where the green cells are within 100' to each other, move them apart vertically.