


## STRAIN POLE ATTACHMENTS

## NOTES:

- 1. STRAP ALL SIGNAL CABLES TO THE SIDE OF THE POLE WITH  $34^{\prime\prime}$  STAINLESS STEEL STRAPS WHEN THE DISTANCE BETWEEN SPAN WIRE ATTACHMENT CLAMP AND WEATHERHEADS EXCEEDS 3'-0".
- 2. PROVIDE MINIMUM TWO SPAN WIRE POLE CLAMPS PER POLE.
- 3. IT IS PROHIBITED TO ATTACH TWO SPAN WIRES AT ONE POLE CLAMP.
- 4. FOR GENERAL REQUIREMENTS, REFER TO NCDOT STANDARD SPECIFICATIONS FOR ROADWAY AND STRUCTURES, JANUARY 2024.

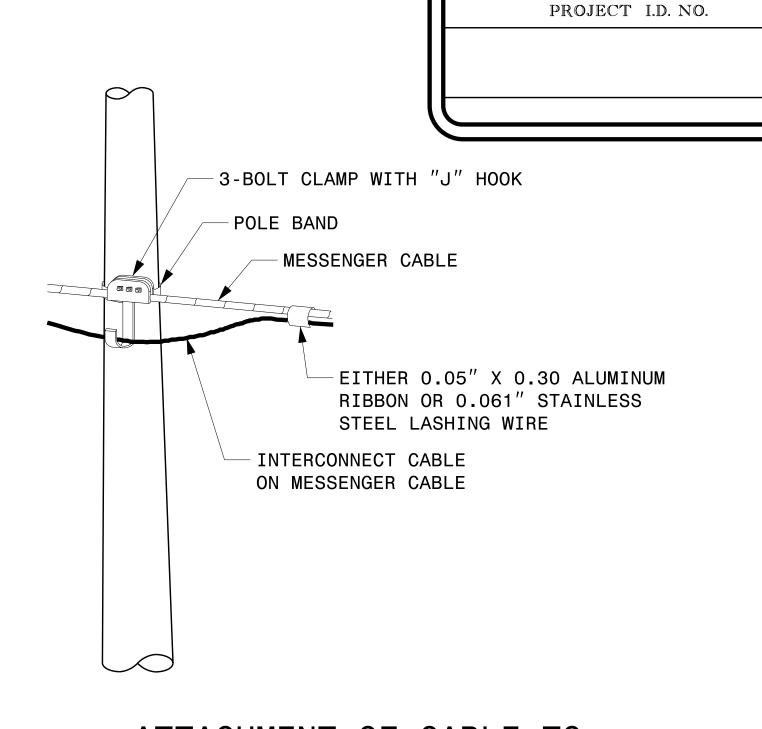


SHEET NO

Sig.M6

Str

## ATTACHMENT OF CABLE TO INTERMEDIATE METAL POLE

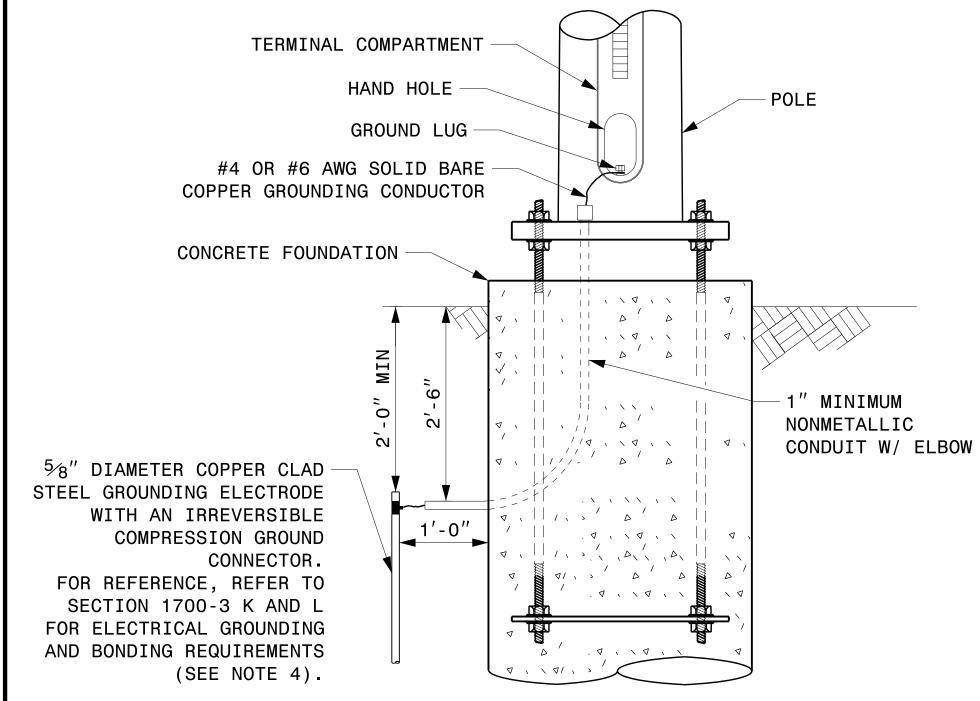

## METAL POLE GROUNDING DETAIL FOR STRAIN POLE AND MAST ARM

